

withdraw. non-aut. circuit-b. with guide frame 3-pole, size I, IEC In=1250A to 690V, AC50/60Hz Icu=66kA at 500V rear connection horizontal without overcurrent release Motorized/manual operating mechanism with spring charging motor AC 50/60 Hz 110-127 V AC or 110-125 V DC Activation 50/60 Hz 110 V AC, 110 V DC With 1st auxiliary release Shunt release "F", F1 50/60 Hz 110 V AC/110 V DC, 100% on-load factor without 2nd auxiliary release 4NO+4NC C22= Ready indicator R10= Arc chute cover withdrawable part not possible with option A05 Rated voltage 1000 V R15= Position signaling switch, withdrawable part 3 changeover contacts R21= Shutter 2-part can be locked with padlock

Further information

Information on the packaging

<https://support.industry.siemens.com/cs/ww/en/view/109813875>

Industry Mall (Online ordering system)

<https://mall.industry.siemens.com/mall/en/en/Catalog/product?mlfb=3WL1112-3AA36-5FA4-Z C22+R10+R15+R21>

Service&Support (Manuals, Certificates, Characteristics, FAQs,...)

<https://support.industry.siemens.com/cs/ww/en/ps/3WL1112-3AA36-5FA4-Z C22+R10+R15+R21>

Image database (product images, 2D dimension drawings, 3D models, device circuit diagrams, ...)





http://www.automation.siemens.com/bilddb/cax_en.aspx?mlfb=3WL1112-3AA36-5FA4-Z C22+R10+R15+R21


CAX-Online-Generator

<http://www.siemens.com/cax>

Tender specifications

<http://www.siemens.com/specifications>

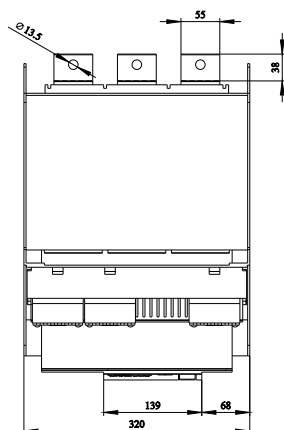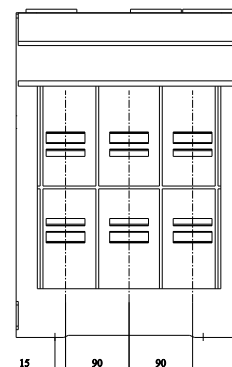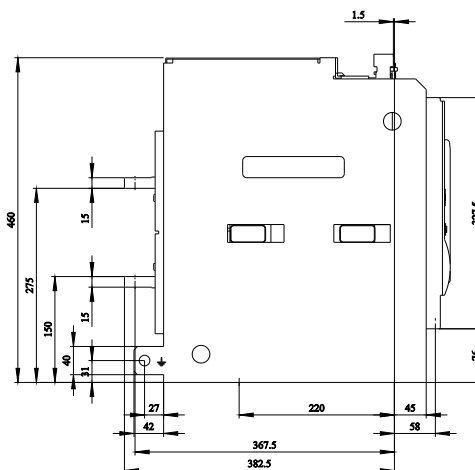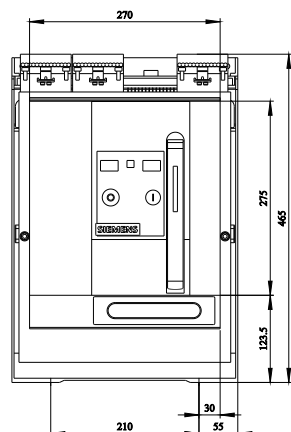

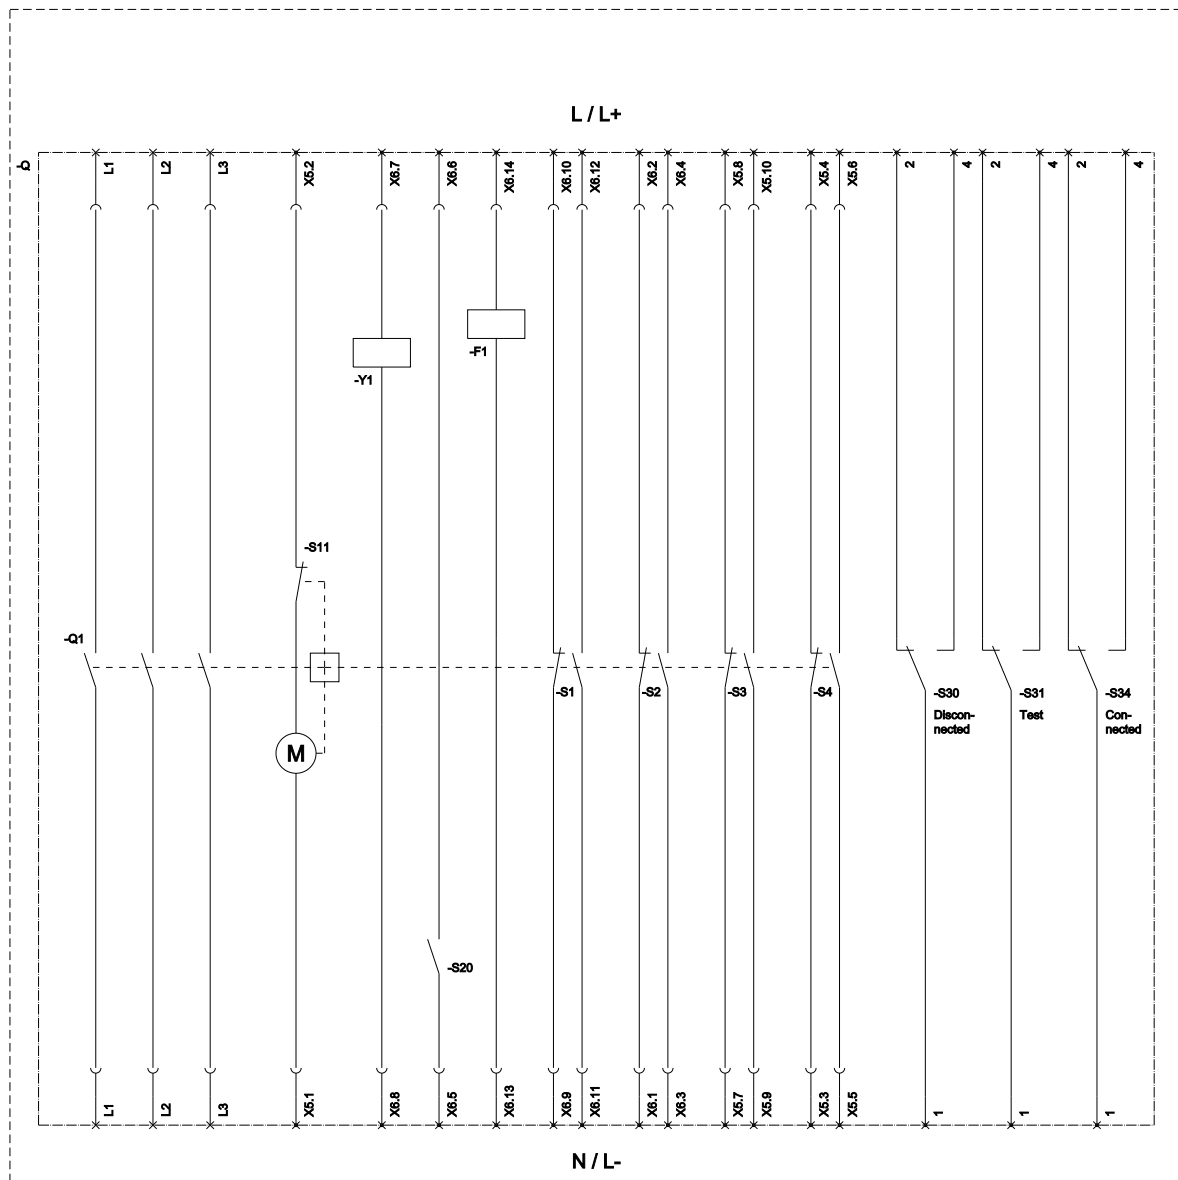

S11 (Internal motor shutdown switch, if spring is tensioned / Interner Motorschaltrelais, wenn Feder gespannt); F1 (1st auxiliary release / Erster Hilfsauslöser);
S1 - S8 (Auxiliary switch / Hilfschalter); S20 (Ready to close signalling switch / Einschaltbereitschaftsmeldeswitch); Y1 (Closing coil / Einschaltmagnet);

last modified:

11/5/2024

