




Fibre optic through beam sensor

FE-11-EPA-M4/F1X0,5/2M

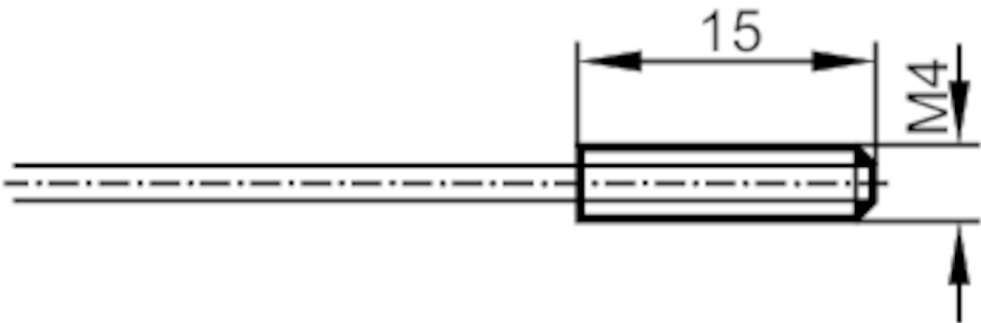

Application		
Function principle		Through-beam sensor
Detection zone		
Range with fibre optic amplifier type		OB50; OBF; OO50
OB50		
Range of fibre optics	[mm]	60
OBF		
Range of fibre optics	[mm]	130
OO50		
Range of fibre optics	[mm]	160
Operating conditions		
Ambient temperature	[°C]	-40...70

E20612



Fibre optic through beam sensor

FE-11-EPA-M4/F1X0,5/2M

Mechanical data	
Weight [g]	35.2
Version of sensing head	straight
Sensing head thread	M4
Sensing head length [mm]	15
Total length [mm]	2000
Min. bending radius [mm]	10
Fibre arrangement	●
Core diameter [mm]	0.5
Fibre material	PMMA
Fibre head material	aluminium
Fibre sheath material	PE
Accessories	
Accessories (supplied)	hexagon nuts: 4 x M4
	tooth lock washers: 4
	Adapter: OBF
	Adapter: OOF
Accessories (optional)	Cutter for fibre optics, E20600
Remarks	
Pack quantity	1 pcs.