




Fibre optic through beam sensor

FE-11-EPA-M3/F1x0,5/2M

Status Archive

/E20750

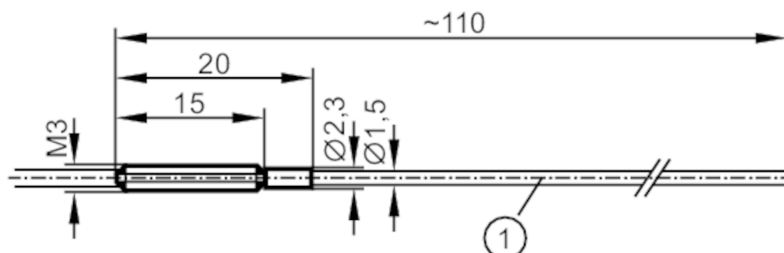

1 bendable

Application

Function principle Through-beam sensor

Detection zone

Range with fibre optic amplifier type OB50; OBF; OO50

OB50

Range of fibre optics [mm] 60

OBF

Range of fibre optics [mm] 130

OO50

Range of fibre optics [mm] 160

Operating conditions

Ambient temperature [°C] -40...70

Mechanical data

Weight [g] 0.038

Version of sensing head bendable

Total length [mm] 2000

Min. bending radius [mm] 15

Fibre arrangement

Core diameter [mm] 0.5

Materials threaded sleeve: brass white bronze coated

Fibre material PMMA

Fibre head material stainless steel (1.4301 / 304)

Fibre sheath material PE

E20751



Fibre optic through beam sensor

FE-11-EPA-M3/F1x0,5/2M

Accessories	
Accessories (supplied)	hexagon nuts: 4 x M3
	tooth lock washers: 4
	Adapter: OBF
	Adapter: OOF
Accessories (optional)	Cutter for fibre optics, E20600
Remarks	
Pack quantity	1 pcs.

Status Archive

/E20750