




Fibre optic through beam sensor

FE-11-EPA-Q-/F16X0,265

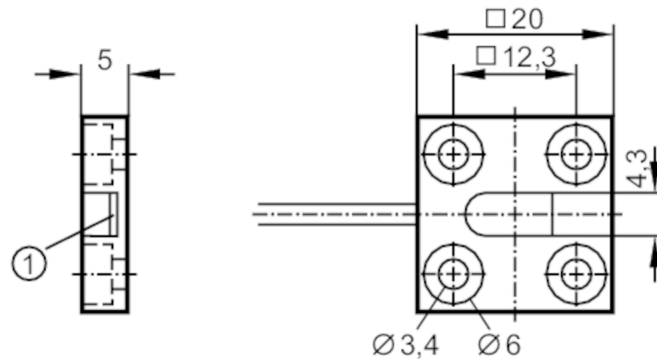

1 light emission

Application

Design	Cross section converter
Function principle	Through-beam sensor

Detection zone

Range with fibre optic amplifier type	OB50; OBF; OO50
---------------------------------------	-----------------

OB50

Range of fibre optics [mm]	150
----------------------------	-----

OBF

Range of fibre optics [mm]	300
----------------------------	-----

OO50

Range of fibre optics [mm]	700
----------------------------	-----

Operating conditions

Ambient temperature [°C]	-40...70
--------------------------	----------

Mechanical data

Weight [g]	60.4
Sensing head height [mm]	5
Sensing head width [mm]	20
Sensing head length [mm]	20
Sensing head length [mm]	5 x 20 x 20
Total length [mm]	2000
Min. bending radius [mm]	9
Fibre arrangement	
Core diameter [mm]	16 x 0.25
Fibre material	PMMA
Fibre head material	aluminium
Fibre sheath material	PE

Accessories

Accessories (optional)	Cutter for fibre optics, E20600
------------------------	---------------------------------

E20757



Fibre optic through beam sensor

FE-11-EPA-Q-/F16X0,265

Remarks

Pack quantity	1 pcs.
---------------	--------